



HISTORIC PRESERVATION CERTIFICATION APPLICATION — PART 1

(Pursuant to the Tax Reform Act of 1976)

Instructions: Applicant should read the instructions carefully before completing application. No Certification may be made unless a completed application form has been received (P.L. 94-455). Use typewriter or print clearly in dark ink to complete the application form. If additional space is needed to complete Part 1, use the reverse side or a separate plain sheet of paper clearly indicating the owner's name and mailing address. Part 1 of this application may be completed and sent to the appropriate State Historic Preservation Officer at any time during the year, and may be sent separately or with Part 2.

PART 1 EVALUATION OF SIGNIFICANCE

1. NAME OF PROPERTY: Pride Tompkins Law Office (hist. name = Godley House)

Address of property: Street 106 West Third Street

City Tuscumbia County Colbert State Alabama Zip Code 35674

Name of historic district in which property is located: _____

2. DESCRIPTION OF PHYSICAL APPEARANCE:

(see instructions for map and photograph requirements—use reverse side if necessary)

See Reverse Side

3. STATEMENT OF SIGNIFICANCE:

(use reverse side if necessary)

Date of construction (if known): ca. 1820's Original site Moved Date of alterations (if known): See item 2

4. NAME AND MAILING ADDRESS OF OWNER:

Name N. Pride Tompkins

Street 106 West Third Street

City Tuscumbia State Ala. Zip Code 35674

Telephone Number (during day): Area Code 1-205-383-0854

I hereby attest that the information I have provided is, to the best of my knowledge, correct, and that I am owner of the property described above.

Signature _____ Date _____

For office use only

The structure described above is included within the boundaries of the National Register historic district and contributes does not contribute to the character of the district.

The structure appears does not appear to meet National Register Criteria for Evaluation (36 CFR 60.6) and will likely will not be nominated to the National Register in accord with the Department of the Interior procedures (36 CFR 60).

The structure is located in a district which appears does not appear to meet National Register Criteria for Evaluation (36 CFR 60.6), will likely will not be nominated to the National Register in accord with Department of the Interior procedures (36 CFR 60), and appears does not appear to contribute to the character of said district.

Signature _____ Date _____
State Historic Preservation Officer

This property has been evaluated according to the criteria and procedures set forth by the Department of the Interior (36 CFR 67) and, if subject to depreciation under section 167 of the Internal Revenue Code of 1954,

is hereby certified a historic structure.

does not contribute to the character of the historic district and does not merit certification as a historic structure. Reasons given on the attached sheet.

Signature _____ Date _____
Keeper of the National Register

NUMBER
2

Architectural feature part'n. between rm. B-1 & B-2
Approximate date of feature mid 20th. century

Describe work and impact on existing features

Describe existing feature modern wood stud and plywood partition and modern 6-panel door

Remove partition to re-open this area as it was in the late 19th. cent. as evidenced by the beam and columns shown on photo 10.

Photo no 10,20 Drawing no 2

NUMBER
3

Architectural feature wardrobe at rm. C-1
Approximate date of feature mid 20th. century

Describe work and impact on existing features

Describe existing feature makeshift wardrobe added by chimney in late 19th. century room

remove wardrobe and refinish surfaces thus exposed.

Photo no 24 Drawing no 2

NUMBER
4

Architectural feature Lunch Room (Kitchen)
Approximate date of feature early 20th. century

Describe work and impact on existing features:

Describe existing feature Kitchen was originally back porch. Roof has leaked, rotting the floor and collapsing the gyp. bd. ceiling.

Rehabilitate the room as a lunch room, and add a rest room and a unit kitchen. Rehabilitate two existing adjacent bath rooms as rest rooms.

Photo no 21 Drawing no 2

NUMBER
5

Architectural feature Rm. A-1 mantle
Approximate date of feature ca. 1920's

Describe work and impact on existing features

Describe existing feature: crude painted brick "mantle" in the bungalow style.

Replace the crude bungalow mantle with the late 19th. century wood mantle which is stored in the shed at the rear of the property and which is thought to have been in this house at one time.

Photo no 12 Drawing no 2

Continuation sheets attached: yes no

Name and mailing address of owner:

Name N. Pride Tompkins
Street 106 West Third Street
City Tuscumbia State Ala. Zip 35674
Telephone Number (during day): 383-0854

I hereby apply for certification of rehabilitation work described above for purposes of Section 2124 of the Tax Reform Act of 1976. I hereby attest that the information I have provided is, to the best of my knowledge, correct, and that I am owner of the property described above.

Owner's Signature _____ Date _____

UNITED STATES DEPARTMENT OF THE INTERIOR Office of Archeology and Historic Preservation Washington, D.C. 20240



HISTORIC PRESERVATION CERTIFICATION APPLICATION — PART 2

(Pursuant to the Tax Reform Act of 1976)

Instructions: Applicant should read the instructions carefully before completing application. No Certification may be made unless a completed application form has been received (P.L. 94-455). Use typewriter or print clearly in dark ink to complete the application form. If additional space is needed to complete Part 2, attach additional blank sheets. Part 2 of this application may be completed and sent to the appropriate State Historic Preservation Officer at any time during the year and may be sent separately or with Part 1.

Part 2 DESCRIPTION OF REHABILITATION

1. NAME OF PROPERTY: Pride Tompkins Law Office (hist. name = Godley House) Address of property: Street 106 West Third Street City Tuscumbia State Ala. Zip Code 35674

If located in National Register historic district, local or State designated district, specify:

2. DATA ON EXISTING STRUCTURE:

Date of construction: ca. 1820's + late 19th. c. + early 20th. c. Existing floor area: 2,655 sq. feet Original use: residence Type of construction: brick + frame

3. DATA ON REHABILITATION PROJECT:

Project starting date (est.): Mar. 30, '80 Project completion date (est.): Oct. 1, 1980 Estimated cost of rehabilitation: \$50,000 Proposed use: Law Office Number of housing units to be created (if applicable): N/A Has the property received Federal or State financial assistance? no If yes, specify source: N/A Are architectural plans and specifications available for review? yes Architect's or developer's name and address: Jones & Herrin, Architects, A.I.A. Huntsville, Alabama Telephone Number: 1-205-539-0764

4. DETAILED DESCRIPTION OF REHABILITATION/PRESERVATION WORK—includes site work, new construction, alterations, etc. Complete blocks below.

Table with 2 columns: NUMBER (1) and Describe work and impact on existing features. Content includes: Architectural feature, Approximate date of feature, Describe existing feature: In general, the building will be rehabilitated to its latest stage of modification except as listed below and as shown on the drawings and notes.

Photo no. Drawing no.

2. Description of Physical Appearance:

EXTERIOR:

Originally a Federal Period 2-room brick one-story, gabled hall-and-parlor house with a detached 2-room frame one-story outbuilding. Later in the Federal Period a one-room gabled brick addition was added to the west end of the main house. In the latter 19th. century, 2 "infill" frame rooms were added behind the main house which then connected the Federal outbuilding to the house. Also in the latter 19th. century 2 frame gabled rooms were added to the rear of the east front Federal room, and a rear porch was added. All the above is one-story, with a cellar under the west center room.

In the late 19th. century, a columned and filigree bracketed porch was added to the front of the house, extending about 20' around the east and west sides of the brick portion of the house.

A joint in the front brick wall shows that the front west room was added, as does other architectural evidence (See photo 2).

A frame outbuilding (shed) in dilapidated condition is at the rear of the site. It appears to be early 20th. century or perhaps late 19th. century. It's not considered to be in a repairable condition.

INTERIOR:

In the front three Federal Period rooms, three Federal doors and frames and the heart-pine floor still exist. Sashes have been lowered in the walls and changed to Victorian 2/2, but the Federal flat-arch brick lintels and sill traces are still evident on the exterior (See photo 2). The S.W. and S.E. Federal rooms contain late Victorian mantles, and the south center Federal room contains a crude brick "bungalow" style ca. 1920's mantle, and a late Victorian beam and column pair at the north wall where the original north exterior brick wall was removed. See photos on sheet 4.


The interior of the N.W. Federal Period outbuilding room has been refinished since 1950, and no original finishes are evident except on the exterior west wall. The Federal room east of the above room has been opened to form a porch, but the original finishes are evident as noted on photos 8-A and 22 and on the "Existing Floor Plan".

The two N.E. Victorian period rooms are largely intact except that the mantle is removed from the N.E. room and a post-1950 crude closet has been added in the east-central room. See photos 7, 23, and 24.

The rear central porch has been enclosed in the early 20th. century to form a kitchen. It's roof is too flat to adequately waterproof and the floor is rotted.

The central room was added in the late 19th. century based on the architectural evidence of the columns and beam shown on photos 10 and 11.

69

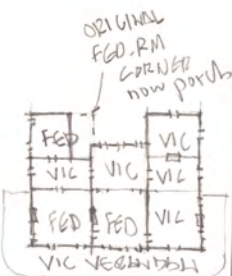

Sketch plan
H →




HQ's 1968 North
5th good in
1993 at
280,000 miles

Fed. + Vic. Godley House
106 W. 3rd St. (at 1st St.)
Tusculum, Al.

photos for renov. (not "restor") HQ's, 1979 (Sept.)

Mounted
June 1993
LJS

Natl. Regis
of Hist.
Place, 1973
Ala. 3567X

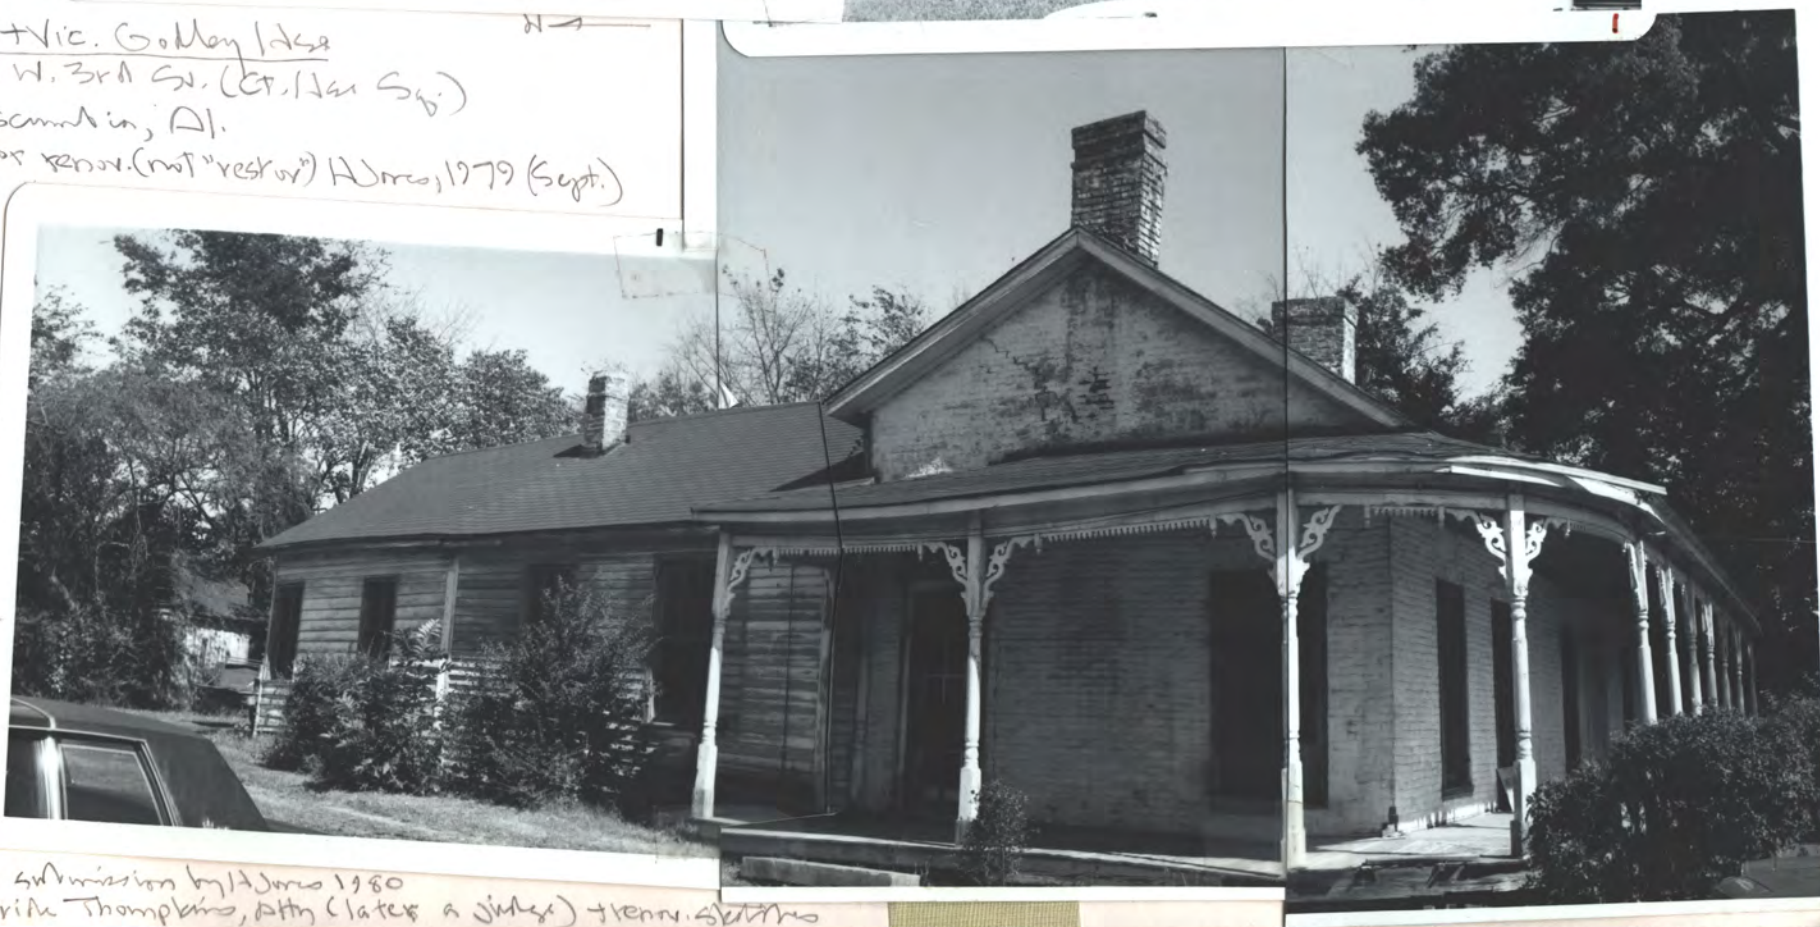


"Tax Act" submission by 14 June 1980
for Price Thompson, Ath (later a judge) + Henry Skiffino

C. 1928 + VIC
GODLEY HOUSE
TUSCULUM ALA

3
4

1820+Vic.
Godley
Hst. - TVSLVM

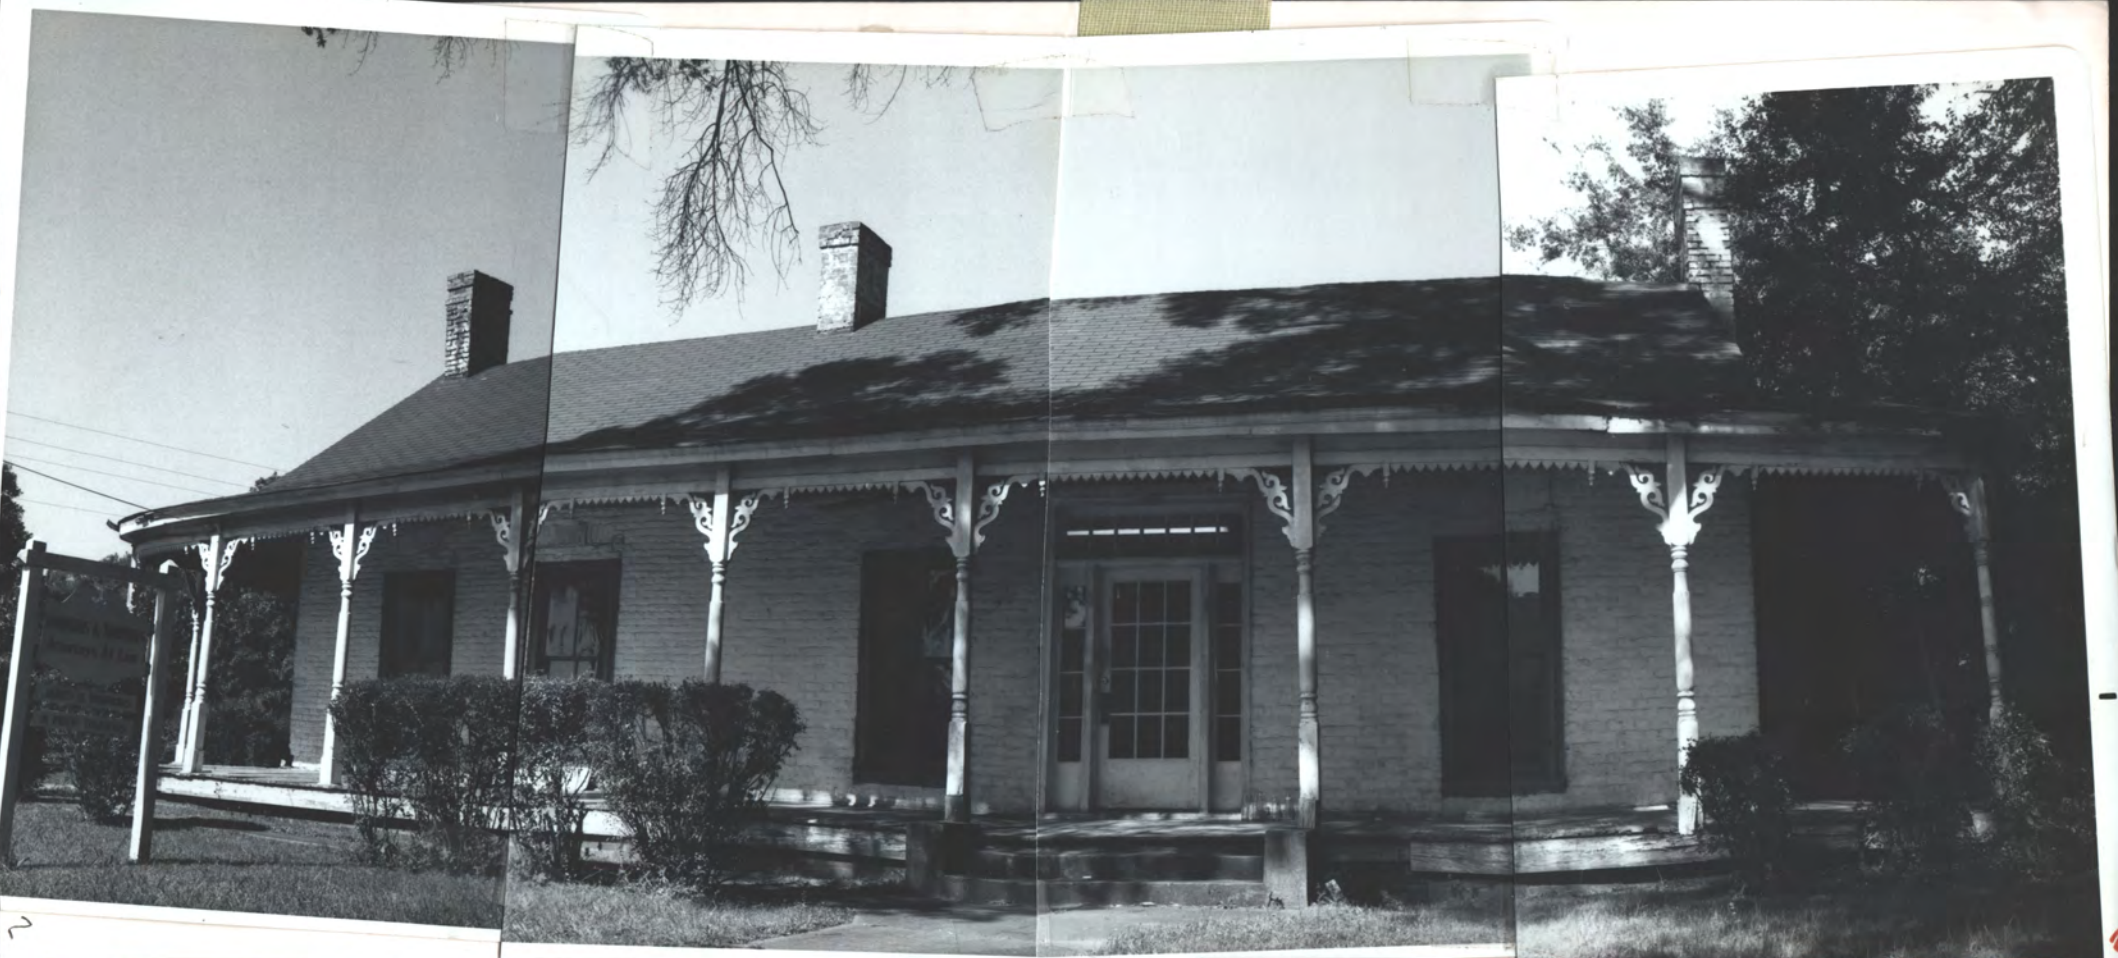

← photos →
not by HJ



5

679

PH



→

68



70



8



← Frame =
Fed.
Sash = Vic.
Banded dry.
= Fed.

4



8-

197



Entry = basically Fed. except c. 1920's
glass door & replacement sash & transom

6
5
4

Heart pine fl.
in Fed. front center
room, 5/4" T&G



Looking into
Fed. front left
room.
Fed. door &
sash frame
(sashes = V&G)
Fed. pine fl.

5

14

15
14



↑ 13




Fed. 6-pnl. hand-planed
 mortised & tenoned & pegged door.
 Front center rm. to left front rm.
 Note above on 1.

14



c. 1920's "bungalow" style mantel
 in Fed. front center rm.

12

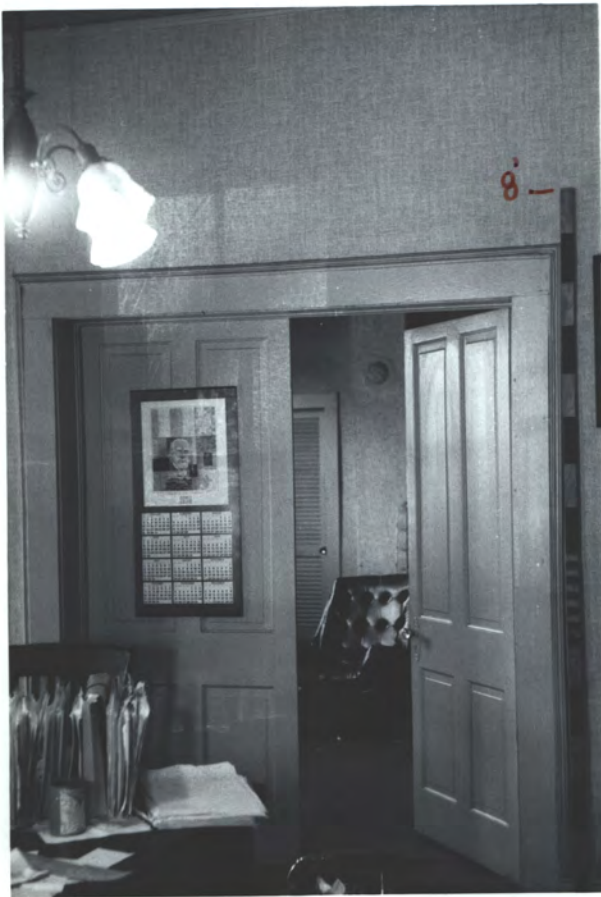


Fed front center rm, looks to rear into
 Infill center rm. Vic. doors

16



Look at left center rm. (Fed. sink moved from
 front Fed. rms) This is a later "Infill" room
 between Fed. front, & serv. bldg.

17

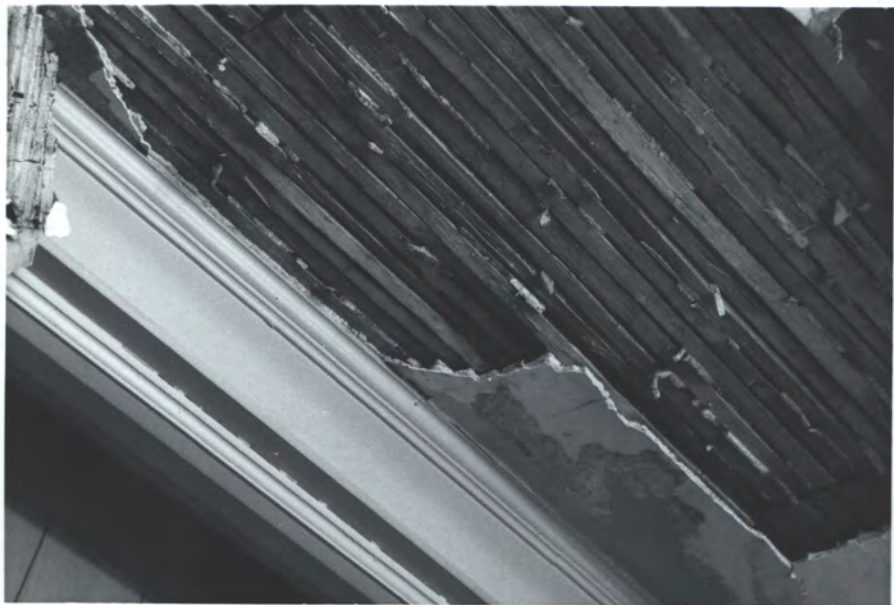

Ceil. at Fed. front center rm.
 (Note split both). Beam = Vic.
 Fed.

↑ 11a




Fed. front center rm. Beam + Col. = Vic.
 Mantel = c. 1920's Bungalow style.
 Note Fed. split-both at ceil.

10



Left Center rm. (infld) behind
 Fed. front center rm. Door = to front rm

23

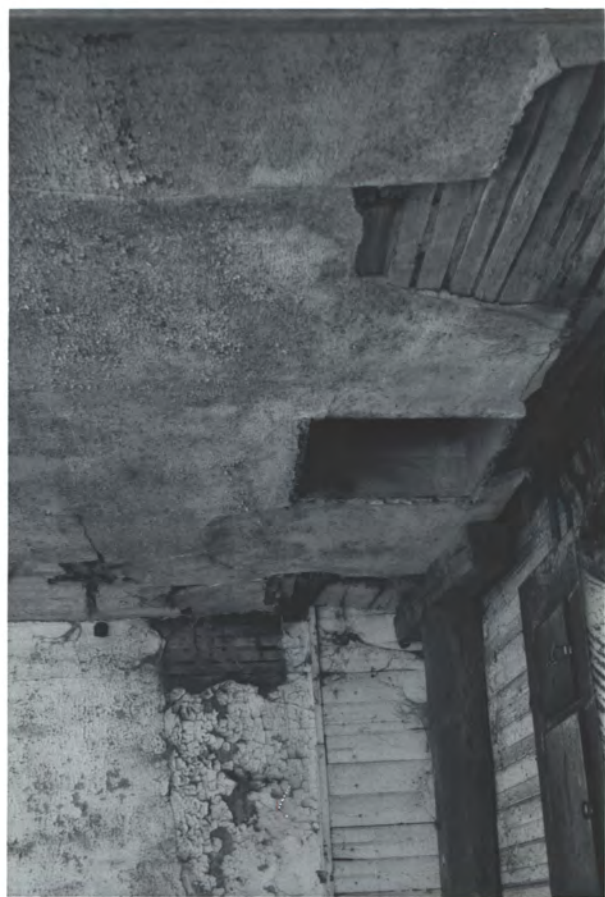

Looking up under "back porch" which was
 an enclosed Fed. rm. Note split (Fed.) both

9



18

Looking from left center "infill" room into Fed. left rear room (remod. c.1960?)



19

Anterior of Fed. left rear room Remod. (c.1960?)



Fed. clapped

Fed.

22

"Closet" at Kit. Note Fed. door & Fed. clapped (beaded) inside. Was ext. wall of a removed rm., now back porch




21

Kit. (makeshift infill rm) looking to front right corner of kit.



Rt. center rm. (Vic.)
 C.A.S. = c. 1960 credit

N-S

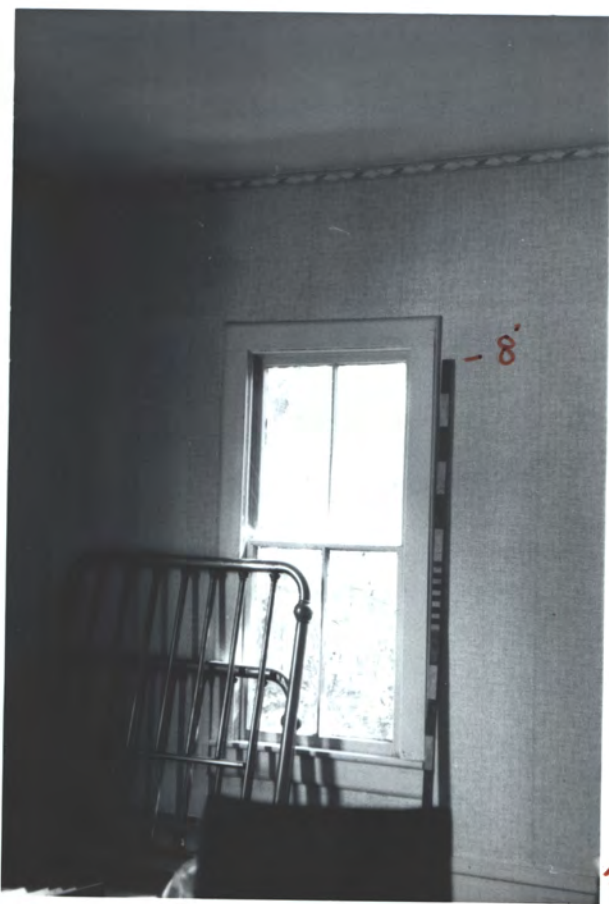

Rt. room
 Vic. Pm

Front Rt.
 Fed Pm
 Late Vic.
 mantel
 of thin
 mod. fl.

